


Home Report



Walker Fraser Steele
Chartered Surveyors

Single Survey

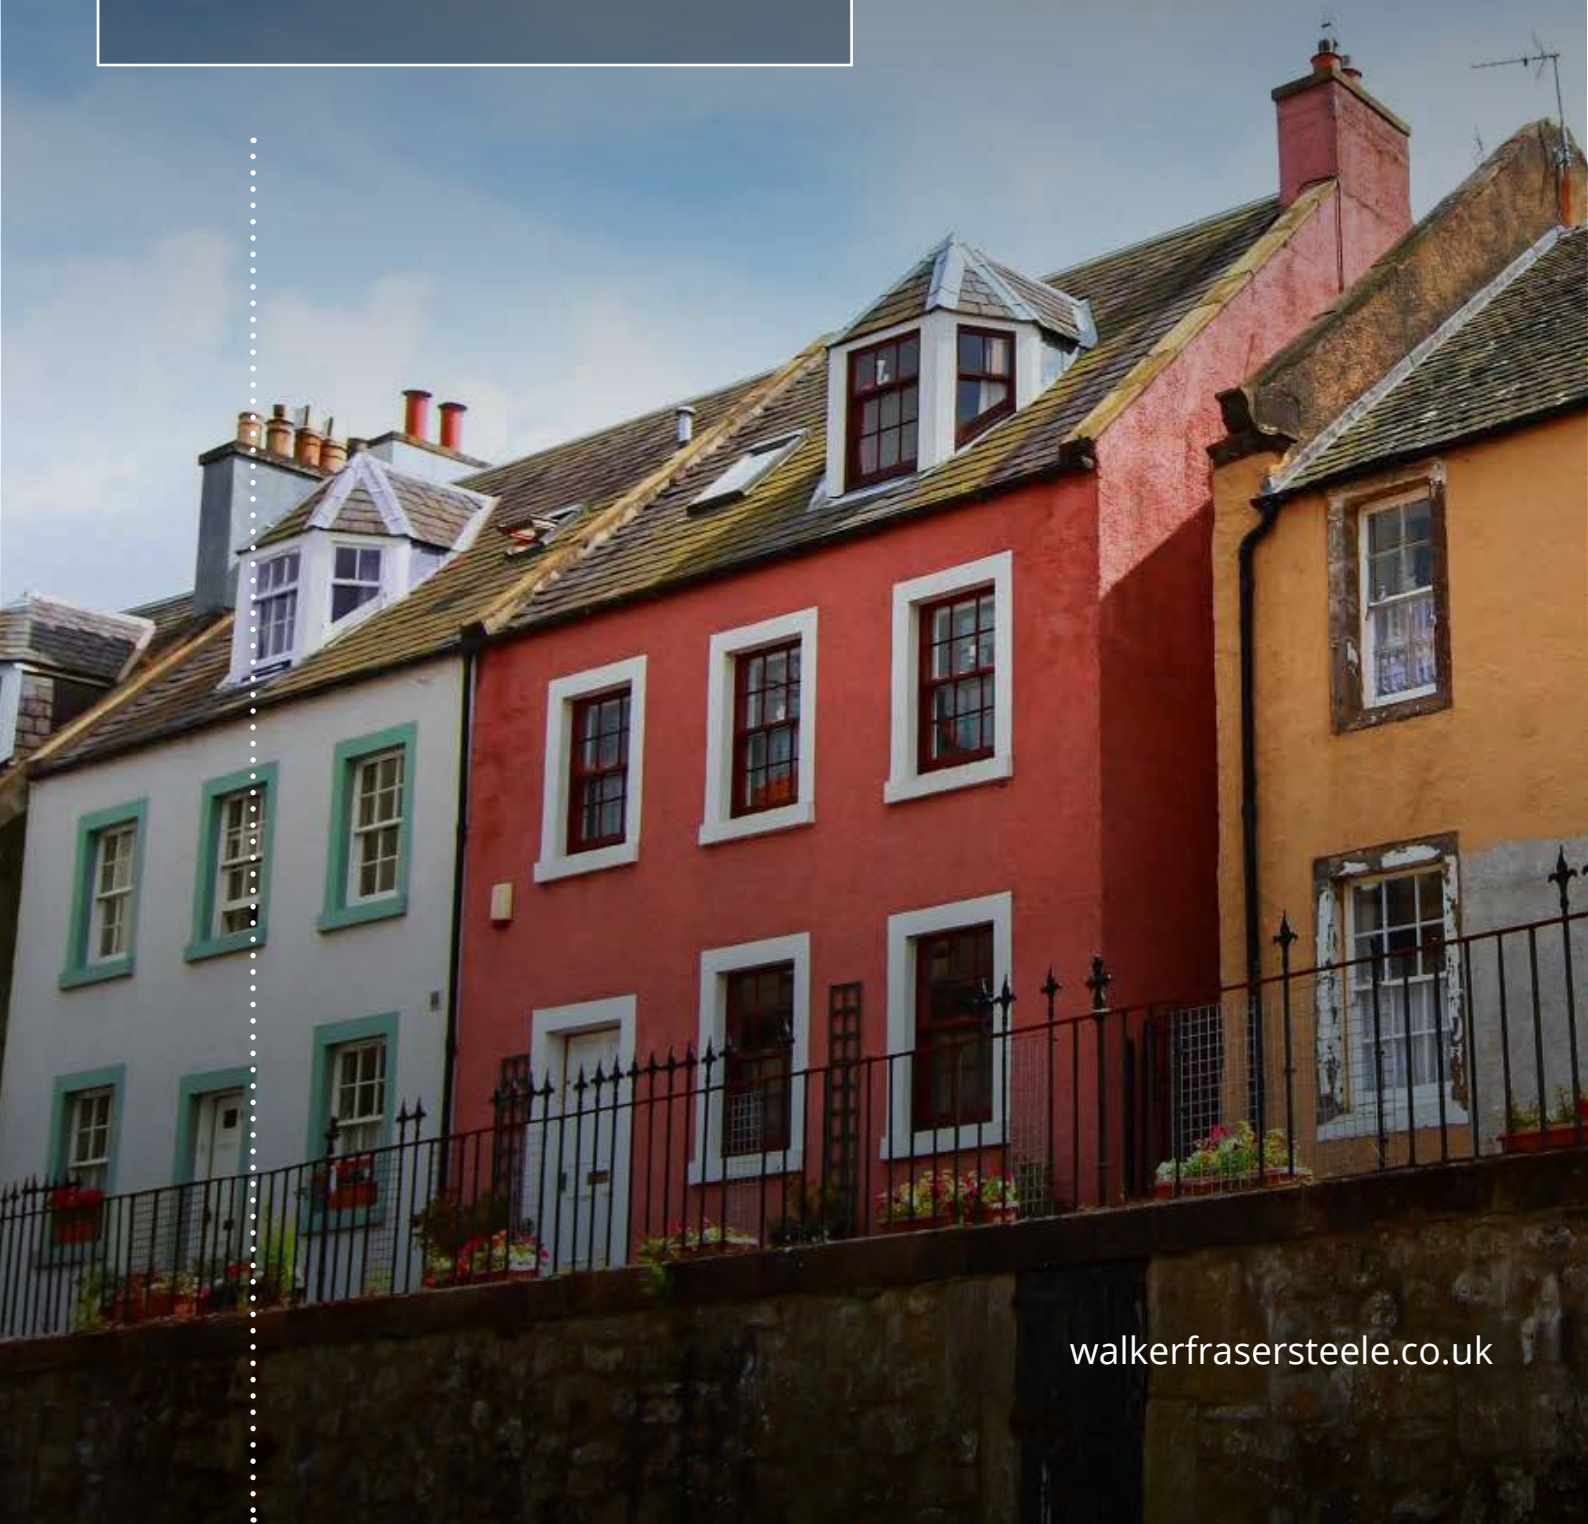

Single Survey

Property Address	4 Castle Street Dornoch IV25 3SR
Customer	Mr Derek & Mrs Shona MacDougall
Date of Inspection	22/04/2026
Prepared by	Jennifer Swanson Walker Fraser Steele

TERMS AND CONDITIONS

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who will have sufficient current local knowledge of the particular market to competently survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by checking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3

LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential Surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4

GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5

TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6

INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7

PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8

CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as

detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

¹Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

²Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is

made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The property comprises a category C listed semi-detached four bedroom house, with attached garage, set in an area of garden ground.
Accommodation	Ground Floor: Hall, Sitting room, Bathroom, Snug and Kitchen/Diner First Floor: Landing and two Bedrooms (both with en-suite Shower room facilities) First Floor Accessed via the Kitchen: Study Second Floor: Landing and two Bedrooms
Gross internal floor area (sqm)	165 or thereby
Neighbourhood and location	The property is located to the heel of the pavement of Castle Street in Dornoch in the East Sutherland coast. The property is located within the Conservation area. The property is within walking distance of shops, school and a range of other amenities.
Age	Built circa 1864
Weather	At the time of the inspection, it was dry.
Chimney stacks	Visually inspected with the aid of binoculars where required. There are three stone chimney stacks which are pointed externally with stone copes, fireclay pots and mortar flashing. It is understood that a chimney stack is shared with the adjoining property.

Roofing including roof space	<p>Sloping roofs were visually inspected with the aid of binoculars where required.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defines as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>Roofs are prone to water penetration in extreme storms but it is not always possible for surveyors to identify this likelihood in good or dry weather. All slated roofs in particular should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.</p> <p>The roof is pitched and slate clad with lead ridging, lead valley and stone skews. Two timber framed dormer windows have been let into the roof on the front elevation and skylight has been let into the rear elevation. A dormer window and a skylight have been let into the roof over the Kitchen/Diner and Study.</p> <p>There was no available access to any roof space.</p>
Rainwater fittings	<p>Visually inspected with the aid of binoculars where required.</p> <p>Rainwater fittings are formed in cast iron.</p>
Main walls	<p>Visually inspected with the aid of binoculars where required.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The main walls are solid stone construction and pointed on the outer face. Sections of walls to the rear projection are roughcast on the outer face.</p> <p>The type of damp-proof course to the main walls cannot be ascertained.</p>

Windows, external doors and joinery	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible. Doors and windows were not forced open.</p> <p>The windows are mainly traditional timber sash and case with single glazing. The window in the Kitchen/Diner is double glazed with timber casement. The skylight on the second floor Landing is single glazed with metal casement. The skylight to the Study is double glazed with metal casement.</p> <p>The external doors are timber framed and panelled.</p>
External decorations	<p>Visually inspected</p> <p>The external joinery has a paint finish. The roughcast walls are finished in masonry paint. The cast iron rainwater goods have a paint finish.</p>
Conservatories / porches	None
Communal areas	None
Garages and permanent outbuildings	<p>Visually inspected</p> <p>There is a single garage attached to the property which is of concrete block construction and roughcast externally under a mono-pitched roof clad in corrugated sheeting. There is a metal "up and over" vehicle access door to the front and a timber access door to the side. The garage has a power and light supply and has been plumbed.</p>
Outside areas and boundaries	<p>Visually inspected</p> <p>The garden grounds are to the rear of the property. To the very rear there is a hard landscaped section down to gravel enclosed by Bradstone screen wall blocks and a retaining dry stone wall at the very rear.</p> <p>There is also a section down to grass between the hard landscaped area and the garage. Between the garage and property there is hard landscaped paved patio area enclosed by stone wall with timber fencing attached.</p>

Ceilings	Visually inspected from floor level The ceilings are timber framed and clad with lath and plaster. Where repairs or modernisation have been carried out sections may have been replaced with plasterboard which has been taped and filled. The ceilings at first floor level in the Study and at second floor level are coombed. The ceiling in the Study is timber lined.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are timber framed and clad with lath and plaster. Where repairs or modernisation have been carried out sections may have been replaced with plasterboard which has been taped and filled. Some section of internal walls are timber clad.
Floors including sub floors	Surface of exposed floors were visually inspected. No carpets or floor covering were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted “head and shoulders” inspection at the access point. Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch. The floors are suspended timber construction
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The property retains original joinery finishes with regards to skirtings, door surrounds and internal timber framed and panel doors and walls. Proprietary kitchen units have been fitted.

Chimney breasts and fireplaces	<p>Visually inspected. No testing of the flues or fittings was carried out.</p> <p>The chimney breasts are formed in stone and faced with lath and plaster. Where repairs or modernisation have been carried out sections may have been replaced with plasterboard.</p> <p>The fireplaces in the Snug and in the Sitting room have a flag hearth and timber mantel. Wood burning stoves have been fitted in the openings.</p> <p>An oil fired range cooker has been fitted in the fireplace in the Kitchen/Diner. It is understood that it is currently disconnected.</p> <p>There are original fireplaces in each Bedroom with cast iron surrounds and timer mantels. Those in the Bedrooms are no longer in use.</p>
Internal decorations	<p>Visually inspected</p> <p>The walls and ceilings are finished in wallpaper and emulsion. The internal joinery has a paint finish.</p>
Cellars	None
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p> <p>Mains grid supplied electricity. The visible cabling is PVC sheathed and 13 Amp power points have been fitted. The consumer unit and meter are located in an under stair cupboard.</p>
Gas	None
Water, plumbing and bathroom fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Mains supply water. The distribution pipes are in copper and PVC. Ceramic sanitary fittings have been fixed. The hot water cylinder is located in a cupboard in the Study.</p>

Heating and hot water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Central heating is provided by an oil fired boiler to wall mounted radiators. Hot water is provided from the same source. The boiler is located in the Garage. Space heating is supplemented by the wood burning stoves in Sitting room and in the Snug. It is for note that there is electric panel underfloor heating in the Bathroom and both en-suite Shower rooms.</p>
Drainage	<p>Drainage covers etc were not lifted. Neither drains nor drainage system were tested.</p> <p>Drainage is assumed to connect into the public sewer.</p>
Fire, smoke and burglar alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There are smoke alarms located in the Hall and both the first and second floor Landings.</p> <p>There are carbon monoxide alarms located in the Snug, Sitting room, First Floor Bedrooms and Second Floor Bedrooms</p> <p>A heat alarm is located in the Kitchen/Diner.</p> <p>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</p> <p>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</p> <p>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</p>

Any additional limits to inspection	<p>When visually inspected the property insulation was not disturbed, furniture and personal effects (particularly in cupboards) and floor coverings have not been moved.</p> <p>Not all roof coverings were clearly visible due to the height/configuration of the roof and the layout of the site.</p> <p>No access to the roof void was available.</p> <p>No access to the sub floor void was available.</p> <p>The floors were close covered and a detailed inspection of the floor was not possible.</p> <p>Moisture meter readings and the inspection of some areas of internal walls was restricted in part due to furniture placement and the storage of personal belongings.</p> <p>The inspection of some areas of internal walls of the garage was restricted due to the storage of personal belongings.</p> <p>In areas where no inspection was possible, the surveyor has assumed there are no defects that have a material effect on the valuation.</p> <p>The property is of an age where lead pipes may be found within the building's internal plumbing or the buried underground water supply, which can be hazardous to health.</p> <p>There is a possibility that asbestos may be present within components and fittings of properties built prior to the year 2000. It is impossible to positively identify asbestos without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask a specialist to undertake an appropriate test.</p> <p>We have not made checks to ascertain whether the property lies within a Radon area. Further advice should be sought from the National Radiological Protection Board.</p> <p>No checks have been made with regard to flood risk</p> <p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p> <p>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.</p>
--	--

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 1 1	Category 2 2	Category 3 3
No immediate action or repair is needed.	Repairs or replacement requiring future attention, but estimates are still advised.	Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Structural movement	
Repair category:	
Notes	Not Applicable

Dampness, rot and infestation	
Repair category:	1
Notes	There is no evidence indicating any significant dampness, rot or infestation within the limitations and scope of the inspection and report.

Chimney stacks	
Repair category:	2
Notes	<p>Damage was noted to the cope of the chimney stack shared with the adjoining property.</p> <p>Elsewhere chimney stacks appear to be in a fair state of repair within the limitations of our inspection but can be vulnerable to defect and should be regularly maintained.</p>

Roofing including roof space	
Repair category:	1
Notes	Some cracked slates were noted. Given the age of the roof covering regular routine maintenance should be anticipated. A competent roofing contractor should be instructed to inspect the roofs and carry out all appropriate repairs and provide advice on future repair/replacement liabilities.

Rainwater fittings	
Repair category:	1
Notes	<p>General wear and tear and some areas of corrosion/rust were noted. Ongoing regular maintenance will be required.</p> <p>We would highlight that it was not raining at the time of our inspection and we would recommend that all rainwater fittings be inspected during heavy rainfall in order to ensure they are free from defect.</p>

Main walls	
Repair category:	1
Notes	<p>There are some minor pointing defects and areas of stone delamination.</p> <p>Ongoing maintenance will be required. Repairs to traditional stone materials can be expensive, particularly to ornate finishes.</p>

Windows, external doors and joinery	
Repair category:	1
Notes	<p>The double glazes unit in the Kitchen/Diner has failed and allowed condensation to form between the panes. There is also a cracked pane of glass to the unit in the Kitchen/Diner.</p> <p>It is understood that this will be remedied prior to sale. Checks should be made to verify this.</p>

External decorations	
Repair category:	1
Notes	<p>There are no obvious or significant defects affecting external decorations.</p> <p>Paint finished and decorated external surfaces will require redecoration on a regular basis.</p>

Conservatories / porches	
Repair category:	
Notes	Not Applicable

Communal areas	
Repair category:	
Notes	Not Applicable

Garages and permanent outbuildings	
Repair category:	1
Notes	<p>The roof cladding is believed to be an asbestos containing material. Visible parts do not appear to be damaged, however this material can be a health hazard, especially if disturbed during the course of alterations or other works to the cladding. Professional advice should be sought in circumstances where alterations to the roof cladding are contemplated.</p> <p>No obvious or significant defects are affecting the garage.</p>

Outside areas and boundaries	
Repair category:	1
Notes	<p>Wear and tear was noted to the screen wall blocks and coping.</p> <p>Elsewhere outside areas have been maintained to an acceptable standard.</p> <p>Boundary walls and fences should be regularly checked and maintained as necessary.</p>

Ceilings	
Repair category:	1
Notes	Small areas of the ceilings are affected by cracking.

Internal walls	
Repair category:	1
Notes	There are no obvious or significant defects affecting the internal walls.

Floors including sub floors	
Repair category:	1
Notes	There are no obvious or significant defects affecting flooring.

Internal joinery and kitchen fittings

Repair category:	1
Notes	There are no obvious or significant defects affecting kitchen fittings. There are no obvious or significant defects affecting internal joinery.

Chimney breast and fire places

Repair category:	1
Notes	The fireplaces and stoves are in reasonable condition and appear to be free from significant defect. It should be ensured that all flues, whether in use or not, are kept in a sound condition and are regularly checked and serviced. Flues which are in use would benefit from a regular smoke test.

Internal decorations

Repair category:	1
Notes	There are no obvious or significant defects affecting internal decorations.

Cellars

Repair category:	
Notes	Not Applicable

Electricity

Repair category:	1
Notes	I am advised there is a recent test certificate for the electrical installation. Checks should be made to verify this. It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC / SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IEE regulations.

Gas

Repair category:	
Notes	Not Applicable

Water, plumbing and bathroom fittings

Repair category:	1
Notes	<p>There are no obvious defects affecting the visible plumbing apparatus.</p> <p>There are no obvious reportable defects affecting sanitary ware.</p> <p>No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted.</p>

Heating and hot water

Repair category:	1
Notes	<p>At the time of inspection the heating system was in use and appeared to be functioning in an acceptable fashion, although this should be confirmed by a suitably qualified contractor.</p> <p>It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements.</p>

Drainage

Repair category:	1
Notes	<p>There are no obvious defects affecting the foul or surface water drainage systems.</p> <p>Systems not tested. Underground drainage and manholes were not inspected. A limited surface visual inspection found no reportable items of disrepair.</p>

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement		Category 1 1 No immediate action or repair is needed.
Dampness, rot and infestation	1	
Chimney stacks	2	Category 2 2 Repairs or replacement requiring future attention, but estimates are still advised.
Roofing including roof space	1	
Rainwater fittings	1	Category 3 3 Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
Main walls	1	
Windows, external doors and joinery	1	
External decorations	1	
Conservatories / porches		
Communal areas		
Garages and permanent outbuildings	1	
Outside areas and boundaries	1	
Ceilings	1	
Internal walls	1	
Floors including sub floors	1	
Internal joinery and kitchen fittings	1	
Chimney breasts and fireplaces	1	
Internal decorations	1	
Cellars		
Electricity	1	
Gas		
Water, plumbing and bathroom fittings	1	
Heating and hot water	1	
Drainage	1	

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes
3. Is there a lift to the main entrance door of the property?	No
4. Are all door openings greater than 750mm?	No
5. Is there a toilet on the same level as the living room and kitchen?	Yes
6. Is there a toilet on the same level as a bedroom?	Yes
7. Are all rooms on the same level with no internal steps or stairs?	No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

It is assumed that a Property Enquiry Certificate will be exhibited and that the property has a clear Title.

The property is listed.

The property is in a conservation area.

The exact extent of the boundaries should be confirmed by the Title Deeds.

In respect of any mutual boundaries, any shared maintenance liabilities or responsibilities require verification.

The property is accessed by a shared drive. Confirm the ownership and rights of access. The valuation assumes that there are no onerous restrictions or liabilities.

It is understood alterations have been carried out with regards to an internal door opening being closed off and reconfiguration of en-suite facilities, the valuation assumes that all necessary Local Authority and other consents have been obtained for alterations and appropriate documentation, including building warrants and completion certificates issued. If any works did not require consent it is assumed that they meet the building standards required by the building regulations or are exempt.

The Solicitor/Conveyancer must ensure that any prospective purchaser fully understands the nature, criteria and basis of a Home Report and in particular what a Home Report is and what it is not (an exhaustive Condition Report) This should be done before any prospective purchaser makes an offer for this property based on the content of this report. If the Solicitor or purchaser requires any clarification in relation to this they must contact the surveyor or familiarise themselves with the nature and criteria of this type of report.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialists or contractors advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

Estimated re-instatement cost (£) for insurance purposes

SEVEN HUNDRED AND SIXTY THOUSAND POUNDS (£760,000)

The property is a Listed Building and falls outside the BCIS tables. The insurance figure is for guidance purposes only as it has been calculated on the basis of equivalent modern reinstatement. Re-instatement may be required as existing; a detailed rebuilding cost appraisal is recommended

Valuation (£) and market comments

FOUR HUNDRED AND SIXTY FIVE THOUSAND POUNDS (£465,000)

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.

Report author:	Jennifer Swanson
Company:	Walker Fraser Steele
Address:	First Floor, Suite 1/3, Cadell House 27 Waterloo Street Glasgow G2 6BZ
Electronically Signed By:	Jennifer Swanson
Date of report:	22/04/2026



Mortgage Valuation

Case Details

Seller name(s):	Mr & Mrs Macdougall		
Address line 1:	4 Castle Street		
Address line 2:			
Address line 3:			
Town / City:	Dornoch	County:	
Postcode:	IV25 3SR		
Date of inspection (dd/mm/yyyy):	22/04/2026		

Property Details

Property type:	House
Property style:	Semi-Detached
Was the property built for the public sector?	No

Specific details for: flats & maisonettes

Floor of property:	<input type="text"/>	Number of floors in block:	<input type="text"/>	Number of units in block:	<input type="text"/>	Lift available in block?	<input type="text"/>
--------------------	----------------------	----------------------------	----------------------	---------------------------	----------------------	--------------------------	----------------------

Tenure

Tenure:	Absolute Ownership
---------	--------------------

If Leasehold:

Unexpired term (years):	<input type="text"/>	Ground rent (pa):	£ <input type="text"/>
-------------------------	----------------------	-------------------	------------------------

Accommodation

No. of living room(s):	2	No. of bedroom(s):	4	No. of kitchen(s):	1
No. of bathroom(s):	3	No. of WC(s):	0	No. of other room(s):	1
Description of other room(s):	1 Study				
Floor area (m ²):	197	Floor area type:	External		

Garages & Outbuildings

Garages / Parking space(s):	1 single garage. 2 parking spaces.
Permanent outbuildings:	None.

Construction

Wall construction:	Solid Stone
Roof construction:	Pitched slate
Approximate year of construction:	1864
Any evidence of alterations or extensions?	No
Alterations or extension details:	

Risks

Is there any evidence of movement to the property?

No

If yes, does this appear longstanding?

Are there any further risk factors?

No

If yes, please provide details:

Services

Electricity:

Mains

Gas:

None

Water:

Mains

Central heating:

Full

Drainage:

Mains

Provide comments:

Oil fired boiler to rads

Legal Matters

Are there any apparent legal issues to be verified by the conveyancer?

Yes

If yes, please provide details:

It is assumed that a Property Enquiry Certificate will be exhibited and that the property has a clear Title.
The property is listed.
The property is in a conservation area.
The exact extent of the boundaries should be confirmed by the Title Deeds.
In respect of any mutual boundaries, any shared maintenance liabilities or responsibilities require verification.
The property is accessed by a shared drive. Confirm the ownership and rights of access. The valuation assumes that there are no onerous restrictions or liabilities.
It is understood alterations have been carried out with regards to an internal door opening being closed off and reconfiguration of en-suite facilities, the valuation assumes that all necessary Local Authority and other consents have been obtained for alterations and appropriate documentation, including building warrants and completion certificates issued. If any works did not require consent it is assumed that they meet the building standards required by the building regulations or are exempt.
The Solicitor/Conveyancer must ensure that any prospective purchaser fully understands the nature, criteria and

Location

Location details:

The property is situated within a mainly residential area with a good level of local amenities.

Roads


Road description:

The road has been adopted.

General Remarks

The property is in a condition consistent with one of its age and type of construction
The surrounding properties are of a similar age and type of construction.

None

 Mortgageability Remarks

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.

 Valuation

Market value in present condition:	£ 465000
Market value after essential repairs:	£
Insurance reinstatement value:	£ 760000
Retention required? <input type="checkbox"/> No	Retention amount: £

 Declaration

Surveyor name:	Jennifer Swanson
Surveyor qualifications:	MRICS
Report date (dd/mm/yyyy):	22/04/2026
Company name:	Walker Fraser Steele
Address:	First Floor, Suite 1/3, Cadell House 27 Waterloo Street Glasgow G2 6BZ
Telephone number:	01412210442
Email address:	Enquiries@walkerfrasersteele.co.uk
Surveyor signature:	

Energy
Performance
Certificate



Energy Performance Certificate (EPC)

Scotland

Dwellings

OSMAN HOUSE, 4 CASTLE STREET, DORNOCH, IV25 3SR


Dwelling type:	Semi-detached house	Reference number:	0160-2952-1240-2326-1221
Date of assessment:	22 April 2026	Type of assessment:	RdSAP, existing dwelling
Date of certificate:	22 April 2026	Approved Organisation:	ECMK
Total floor area:	174 m ²	Main heating and fuel:	Boiler and radiators, oil
Primary Energy Indicator:	302 kWh/m ² /year		

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£9,456	See your recommendations report for more information
Over 3 years you could save*	£1,905	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

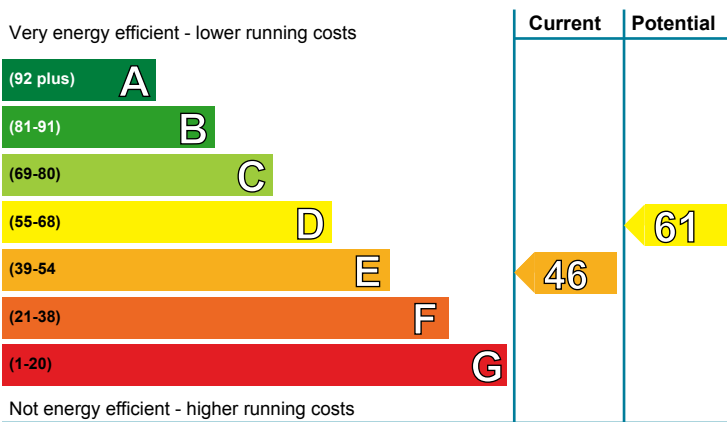


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (46)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

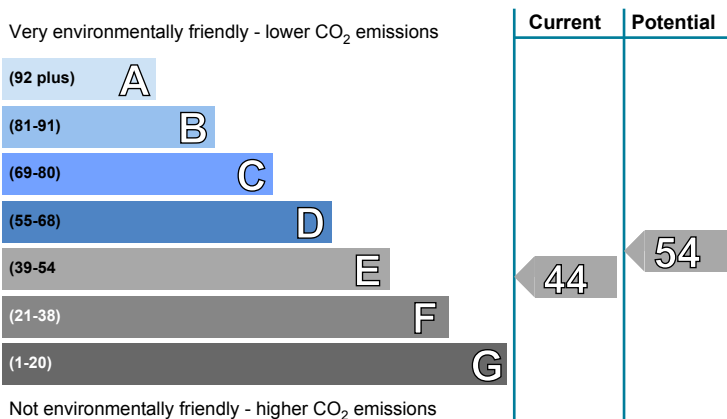

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (44)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal wall insulation	£7,500 - £11,000	£1101.00
2 Floor insulation (suspended floor)	£5,000 - £10,000	£507.00
3 Double glazed windows	£4,500 - £6,000	£300.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction. See the addendum section on the last page of this report for further information relating to items in the table.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Sandstone, with internal insulation	★★★★☆	★★★★☆
Roof	Pitched, insulated (assumed)	★★★★☆	★★★★☆
	Roof room(s), no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Some double glazing	★☆☆☆☆	★☆☆☆☆
Main heating	Boiler and radiators, oil	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	Room heaters, wood logs	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Good lighting efficiency	★★★★☆	★★★★☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 68 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 12 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.8 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.






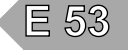

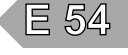
Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£8,409 over 3 years	£6,495 over 3 years	
Hot water	£780 over 3 years	£780 over 3 years	
Lighting	£267 over 3 years	£276 over 3 years	
Totals	£9,456	£7,551	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal wall insulation	£7,500 - £11,000	£367		
2 Floor insulation (suspended floor)	£5,000 - £10,000	£169		
3 Replace single glazed windows with low-E double glazed windows	£4,500 - £6,000	£100		
4 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£225		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Double glazed windows

Double glazing is the term given to a system where two panes of glass are made up into a sealed unit. Replacing existing single-glazed windows with double-glazed windows will improve comfort in the home by reducing draughts and cold spots near windows. Double-glazed windows may also reduce noise, improve security and combat problems with condensation. Building regulations apply to this work and planning permission may also be required, so it is best to check with your local authority on what standards need to be met. A building warrant is not required if the windows comply with the current requirements.

4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present:

- Biomass secondary heating

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	34,389.95	N/A	N/A	N/A
Water heating (kWh per year)	3,256.34			

Addendum

Conservation area

When considering the PV installation consider installing PV battery and a PV diverter for water heating

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by ECMK (www.ecmk.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Jennifer Swanson
Assessor membership number:	ECMK303576
Company name/trading name:	Walker Fraser Steele
Address:	27 Waterloo Street Glasgow G2 6BZ
Phone number:	01412210442
Email address:	jennifer.swanson@esurv.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Property Questionnaire

property questionnaire

Property address	4, Castle Street, DORNOCH, IV25 3SR
-------------------------	-------------------------------------

Seller(s)	Shona and Derek MacDougall
------------------	----------------------------

Completion date of property questionnaire	08/04/2026
--	------------

property questionnaire

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership														
	How long have you owned the property? 10 years														
2.	Council tax														
	Which Council Tax band is your property in? E														
3.	Parking														
	What are the arrangements for parking at your property? (Please tick all that apply) <table><tr><td><input type="checkbox"/> Garage</td><td>Yes</td></tr><tr><td><input type="checkbox"/> Allocated parking space</td><td>No</td></tr><tr><td><input type="checkbox"/> Driveway</td><td>Yes</td></tr><tr><td><input type="checkbox"/> Shared parking</td><td>No</td></tr><tr><td><input type="checkbox"/> On street</td><td>No</td></tr><tr><td><input type="checkbox"/> Resident permit</td><td>No</td></tr><tr><td><input type="checkbox"/> Metered parking</td><td>No</td></tr></table>	<input type="checkbox"/> Garage	Yes	<input type="checkbox"/> Allocated parking space	No	<input type="checkbox"/> Driveway	Yes	<input type="checkbox"/> Shared parking	No	<input type="checkbox"/> On street	No	<input type="checkbox"/> Resident permit	No	<input type="checkbox"/> Metered parking	No
<input type="checkbox"/> Garage	Yes														
<input type="checkbox"/> Allocated parking space	No														
<input type="checkbox"/> Driveway	Yes														
<input type="checkbox"/> Shared parking	No														
<input type="checkbox"/> On street	No														
<input type="checkbox"/> Resident permit	No														
<input type="checkbox"/> Metered parking	No														

property questionnaire

	● Other (please specify):	N/A
4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes

property questionnaire

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	Yes
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? <u>If you have answered yes</u> , please describe below the changes which you have made:	No
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? <u>If you have answered yes</u> , please answer the three questions below:	No
	(i) Were the replacements the same shape and type as the ones you replaced?	
	(ii) Did this work involve any changes to the window or door openings?	
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	Yes Oil

property questionnaire

	<p><u>If you have answered yes or partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>							
	(i) When was your central heating system or partial central heating system installed? 2010 est							
	(ii) Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract: Graham Sewart Plumbing and Heating	Yes						
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year). Feb 2026							
8.	Energy Performance Certificate							
	Does your property have an Energy Performance Certificate which is less than 10 years old?	No						
9.	Issues that may have affected your property							
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it? <u>If you have answered yes</u> , is the damage the subject of any outstanding insurance claim?	No						
b.	Are you aware of the existence of asbestos in your property? <u>If you have answered yes</u> , please give details:	No						
10.	Services							
a. Please tick which services are connected to your property and give details of the supplier:								
	<table border="1"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td> </td> <td> </td> <td> </td> </tr> </tbody> </table>	Services	Connected	Supplier				
Services	Connected	Supplier						

property questionnaire

	Gas or liquid petroleum gas	No	
	Water mains or private water supply	Yes	Scottish Water
	Electricity	Yes	SSE
	Mains drainage	Yes	Scottish Water
	Telephone	Yes	Sky
	Cable TV or satellite	Yes	Sky
	Broadband	Yes	Sky
b.	Is there a septic tank system at your property? <u>If you have answered yes, please answer the two questions below:</u>		No
	(iv) Do you have appropriate consents for the discharge from your septic tank?		
	(v) Do you have a maintenance contract for your septic tank? <u>If you have answered yes, please give details of the company with which you have a maintenance contract:</u>		No
11.	Responsibilities for shared or common areas		
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?		Yes Shared drive, shared chimney stack

property questionnaire

	<p><u>If you have answered yes</u>, please give details:</p>	
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes</u>, please give details:</p>	No
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	No
d.	<p>Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes</u>, please give details:</p>	No
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p>	No

property questionnaire

	<u>If you have answered yes</u> , please give details:	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.) <u>If you have answered yes</u> , please give details:	No
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property? <u>If you have answered yes</u> , please provide the name and address, and give details of any deposit held and approximate charges:	No
b.	Is there a common buildings insurance policy? If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	No
c.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund. Nil	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? <u>If you have answered yes</u> , please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	No

property questionnaire

b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please give details:</p>	No
c.	<p><u>If you have answered yes</u> to 13(a) or (b), do you have any guarantees relating to this work?</p> <p><u>If you have answered yes</u>, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	No

14. Guarantees		
a.	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	No
(ii)	Roofing	No
(iii)	Central heating	No
(iv)	National House Building Council (NHBC)	No
(v)	Damp course	No
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No
b.	<u>If you have answered 'yes' or 'with title deeds'</u> , please give details of the work or installations to which the guarantee(s) relate(s):	

property questionnaire

	N/A	
c.	Are there any outstanding claims under any of the guarantees listed above? <u>If you have answered yes</u> , please give details:	No
15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:	No
16.	Notices that affect your property	
In the past three years have you ever received a notice:		
a.	advising that the owner of a neighbouring property has made a planning application?	No
b.	that affects your property in some other way?	No
c.	that requires you to do any maintenance, repairs or improvements to your property?	No
<u>If you have answered yes to any of a-c above</u> , please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.		

property questionnaire

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Seller(s) : Shona and Derek MacDougall

Date: 08/04/2026



Walker Fraser Steele Chartered Surveyors

For further information, please
call 0141 221 0442 or email
enquiries@walkerfrasersteele.co.uk

Walker Fraser Steele
First Floor
Suite 1/3 Cadell House
27 Waterloo Street
Glasgow
G2 6BZ